

NATIONAL CENTER FOR EARTHQUAKE
ENGINEERING RESEARCH

State University of New York at Buffalo

Reconnaissance Report on the Cairo, Egypt
Earthquake of October 12, 1992

by

M. Khater

EQE International
44 Montgomery St., Suite 3200
San Francisco, California 94104

Technical Report NCEER-92-0033

December 23, 1992


This research was conducted at EQE International and was partially supported by the National Science Foundation under Grant No. BCS 90-25010 and the New York State Science and Technology Foundation under Grant No. NEC-91029.

NOTICE

This report was prepared by EQE International as a result of research sponsored by the National Center for Earthquake Engineering Research (NCEER) through grants from the National Science Foundation, the New York State Science and Technology Foundation, and other sponsors. Neither NCEER, associates of NCEER, its sponsors, EQE International, nor any person acting on their behalf:

- a. makes any warranty, express or implied, with respect to the use of any information, apparatus, method, or process disclosed in this report or that such use may not infringe upon privately owned rights; or
- b. assumes any liabilities of whatsoever kind with respect to the use of, or the damage resulting from the use of, any information, apparatus, method or process disclosed in this report.

Any opinions, findings, and conclusions or recommendations expressed in this publication are those of the author(s) and do not necessarily reflect the views of the National Science Foundation, the New York State Science and Technology Foundation, or other sponsors.

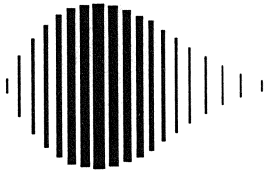

**Reconnaissance Report on the Cairo, Egypt
Earthquake of October 12, 1992**

by

M. Khater¹

December 23, 1992

Technical Report NCEER-92-0033

NCEER Project Number 91-7000A

NSF Master Contract Number BCS 90-25010

and

NYSSTF Grant Number NEC-91029

1 Principal Research Engineer, EQE International

NATIONAL CENTER FOR EARTHQUAKE ENGINEERING RESEARCH
State University of New York at Buffalo
Red Jacket Quadrangle, Buffalo, NY 14261

ACKNOWLEDGEMENTS

This earthquake reconnaissance project was partially supported by NCEER and EQE International. Dr. William Smith, U.S. Agency for International Development; and Mr. Mohamed Magdi Ibrahim, Supervisor of Ministry Cabinet, Ministry of Development, New Communities, Housing and Public Utilities, provided valuable guidance for the author's field survey and information for preparation of this report. The contribution of Dr. Tousson Topozada, Department of Conservation, Division of Mines and Geology, in the seismicity section of this report is much appreciated.

TABLE OF CONTENTS

SECTION	TITLE	PAGE
1	INTRODUCTION	1-1
2	SEISMICITY	2-1
3	EXTENT OF DAMAGE	3-1
3.1	Nonengineered Buildings.....	3-1
3.2	Engineered Buildings.....	3-4
3.3	Lifelines	3-10
4	SUMMARY AND CONCLUSIONS.....	4-1
5	REFERENCES.....	5-1

LIST OF ILLUSTRATIONS

FIGURE	TITLE	PAGE
2-1	Geology map of Cairo and the surrounding area	2-4
2-2	(a) Locations of epicenters of historical and recent medium to large earthquakes; (b) Epicenters of small earthquakes (Kebeasy, 1990)	2-5
2-3	Intensity distribution of the 14 November 1981 earthquake as located by HLW = Helwan; NEIS = National Earthquake Information Service (Kebeasy, R.M., M. Maamoun, and E.M. Ibrahim, 1982).....	2-6
3-1	Damage to unreinforced masonry buildings	3-2
3-2	Collapse of a 14-story concrete-frame building.....	3-6
3-3	42-story high-rise concrete buildings in Cairo experienced only nonstructural damage	3-7
3-4	Nonstructural horizontal cracks in a 14-story concrete-frame building	3-8
3-5	Vertical crack in a 36-story shear wall concrete building due to building irregularity	3-9
3-6	The tallest structure in Cairo (Cairo Tower) sustained only nonstructural damage	3-11
3-7	30-story cylindrical hotel sustained only nonstructural damage.....	3-12
3-8	Structural damage caused by pounding	3-13
3-9	A 5-story concrete-frame hospital sustained only nonstructural damage	3-15
3-10	A main road between Cairo and Asiot settled about 0.5 meters due to lateral spreading	3-16
3-11	An old steel girder bridge with concrete deck lost part of the concrete deck	3-17
3-12	The roofing system of this elevated water tank in the city of Giza was damaged during the earthquake	3-18

LIST OF TABLES

TABLE	TITLE	PAGE
2-1	Summary of Historic and Recent Earthquakes	2-3

SECTION 1 INTRODUCTION

On Monday, October 12, 1992, a magnitude 5.4 (M_s ; $M_b = 5.9$ based on the National Earthquake Information Center, NEIC) earthquake struck Cairo, the heavily populated capital of Egypt. The earthquake struck at 3:15 P.M. local time, and strong ground shaking lasted a reported 30 seconds. The earthquake was centered about 20 kilometers south of Cairo and was felt as far away as Jerusalem, about 500 kilometers to the northeast. An estimated 541 people were killed; 6,518 people injured (1,390 were hospitalized); and about 20,000 people displaced from their homes. Most casualties resulted from people being trampled in the rush to get out of shaking buildings. About 350 building structures collapsed (mainly old unreinforced masonry buildings), and 8,000 were damaged. An estimated 3,500 adobe-type buildings in the surrounding villages collapsed. Among the most catastrophic seismic-induced events was the collapse of a 14-story nonductile concrete building in Cairo, where 61 people were killed. No strong motion instruments existed in the area.

There was no seismic design code in Egypt before the earthquake, and most buildings were not designed for earthquake loads. A first-draft seismic design code for Egypt had been in preparation, and was published a few days after the earthquake. This draft seismic code divides Egypt into two zones. Zone One, which covers most of Egypt including Cairo, represents an area with the potential for earthquakes of magnitude 6.0 or lower. Zone Two represents an area with the potential for earthquakes of magnitude 7.0 or lower, and mainly includes cities on the Red Sea, south Sinai, the city of El-Faiyum, and the city of Aswan.

This report summarizes the author's observations during a brief reconnaissance visit to the area four days after the earthquake, as well as information from other sources.

SECTION 2 SEISMICITY

On October 12 an earthquake of magnitude 5.4 (M_s ; $M_b=5.9$) occurred at a depth of 25 kilometers--as reported by the National Earthquake Information Center (NEIC)--near the Nile Valley, about 20 kilometers south of Cairo. The location of the earthquake's epicenter has been estimated to be 29.83 N and 31.23 E (NEIC). This event was destructive over a large portion of the Cairo metropolitan area, which was entirely located at an epicentral distance of less than one focal depth. Aftershock studies will determine the trend and mechanism of the subsurface causative fault. A preliminary estimate of the Modified Mercalli Intensity (MMI) distribution in Cairo was about VII on soft soil, and about V on good soil. Figure 2-1 shows a geology map of Cairo and the surrounding area.

Egypt is considered one of the few regions of the world where evidence of historic earthquakes activity has been documented during the past 4,800 years. Information of historical earthquakes is documented in the annals of ancient Egyptian history and Arabic literature. According to Sieberg (1932), Ambraseys (1961), Karnik (1969), Maamoun (1979), Ibrahim and Marzouk (1979), Poirier & Taher (1980) and Savage (1984), about 83 events were reported to have occurred in and around Egypt and to have caused damage of variable degrees in different localities. Table 2.1 and Figure 2.2 summarize some of the historic and recent earthquakes in this area.

The most recent previous damaging earthquake ($M=5.3$) near the Nile Valley occurred on November 14, 1981, about 60 kilometers southwest of Aswan High Dam, and about 750 kilometers south of Cairo. Figure 2-3 shows the intensity distribution to this event (Kebeasy 1990). Aftershock studies of that event indicated right lateral strike-slip faulting at a 20-kilometer depth on an east-west trend transverse to the Nile (Toppozada et al. 1984, Kebeasy et al. 1982).


Other damaging earthquakes have occurred near the Nile Valley surrounding Cairo, as shown in Figure 2-2. In 1955 an earthquake of magnitude 6.7 offshore from Alexandria and Rashid (Figure 2-2, area a) killed 20 people,

injured 106, and destroyed hundreds of buildings. In 1870 and 1698 similar earthquakes occurred in the same general area (Maamoun 1979). In 1847 an earthquake in the Faiyum area (Figure 2-2, area c), about 100 kilometers south-southwest of Cairo, killed over 212 people, injured thousands, and destroyed thousands of buildings between Cairo and Faiyum. A similar earthquake occurred near Faiyum in 1303 (Maamoun 1979). In 1754 an earthquake near Tanta (Figure 2-2, area b), in the Nile Delta 50 kilometers north of Cairo, damaged tens of thousands of buildings, and killed and injured thousands of people. A similar earthquake occurred in 2200 B.C., near Zagazig about 50 kilometers east of the 1754 event (Maamoun 1979).

The Red Sea area is seismically active, but is lightly populated compared to the area surrounding the Nile Delta. The most recent damaging earthquake in this area occurred in 1969 ($M=6.8$), near Shadwan Island offshore from Gemsa and Hurghada, 380 kilometers southeast of Cairo. Three people were killed, 15 were injured, and 32 buildings were destroyed (Maamoun et al. 1978).

Table 2-1
SUMMARY OF HISTORIC AND RECENT EARTHQUAKES

Year	Intensity	Location	Reference	Comments
2800 BC	XII	Sharquia Province	Kebeasy 1990	Severe earthquake
1210 BC	VI	near Abu-Simbil	Kebeasy 1990	
221 BC	VII	Siwa Oasis	Maamoun 1979	
27 BC	?	Thebes, Upper Egypt	Kebeasy 1990	Severe earthquake
1068 March 18	?	near Aqaba, at the north end of Gulf of Aqaba	Melville 1984	
1303 August 8	?	Mediterranean sea	Kebeasy 1990	
		offshore of Egypt		
1847 August 7	VIII	near Fayum	Maamoun 1979	55 people were killed 3,000 houses were destroyed
1870 June 24	VII	Mediterranean sea offshore of Egypt	Maamoun 1979	
1955 September 12	VII	Offshore, near Alexan	Maamoun 1979	This event had a magnitude of 6.1
1955 November 12	?	near Abu-Dabbab	Sykes 1964	This event had a magnitude of 5.5
1969 March 31	IX	Shadwan Island MSK scale	Maamoun et al 1978	
1974 April 29	V	Abu-Hammad	Maamoun 1979	This event had a magnitude of 4.9
1978 December 9	?	Gilf El-kebir	Kebeasy et al 1990	This event had a magnitude of 5.3
1981 November 14	VIII	Kalabsha about 60 km southwest of Aswan	Kebeasy et al 1984	This event had a magnitude of 5.5
1983 February 3	?	Gulf of Aqaba	Kebeasy 1990	This event had a magnitude of 4.9
1984 July 2	?	Abu-Dabbab	Kebeasy 1990	This event had a magnitude of 5.1

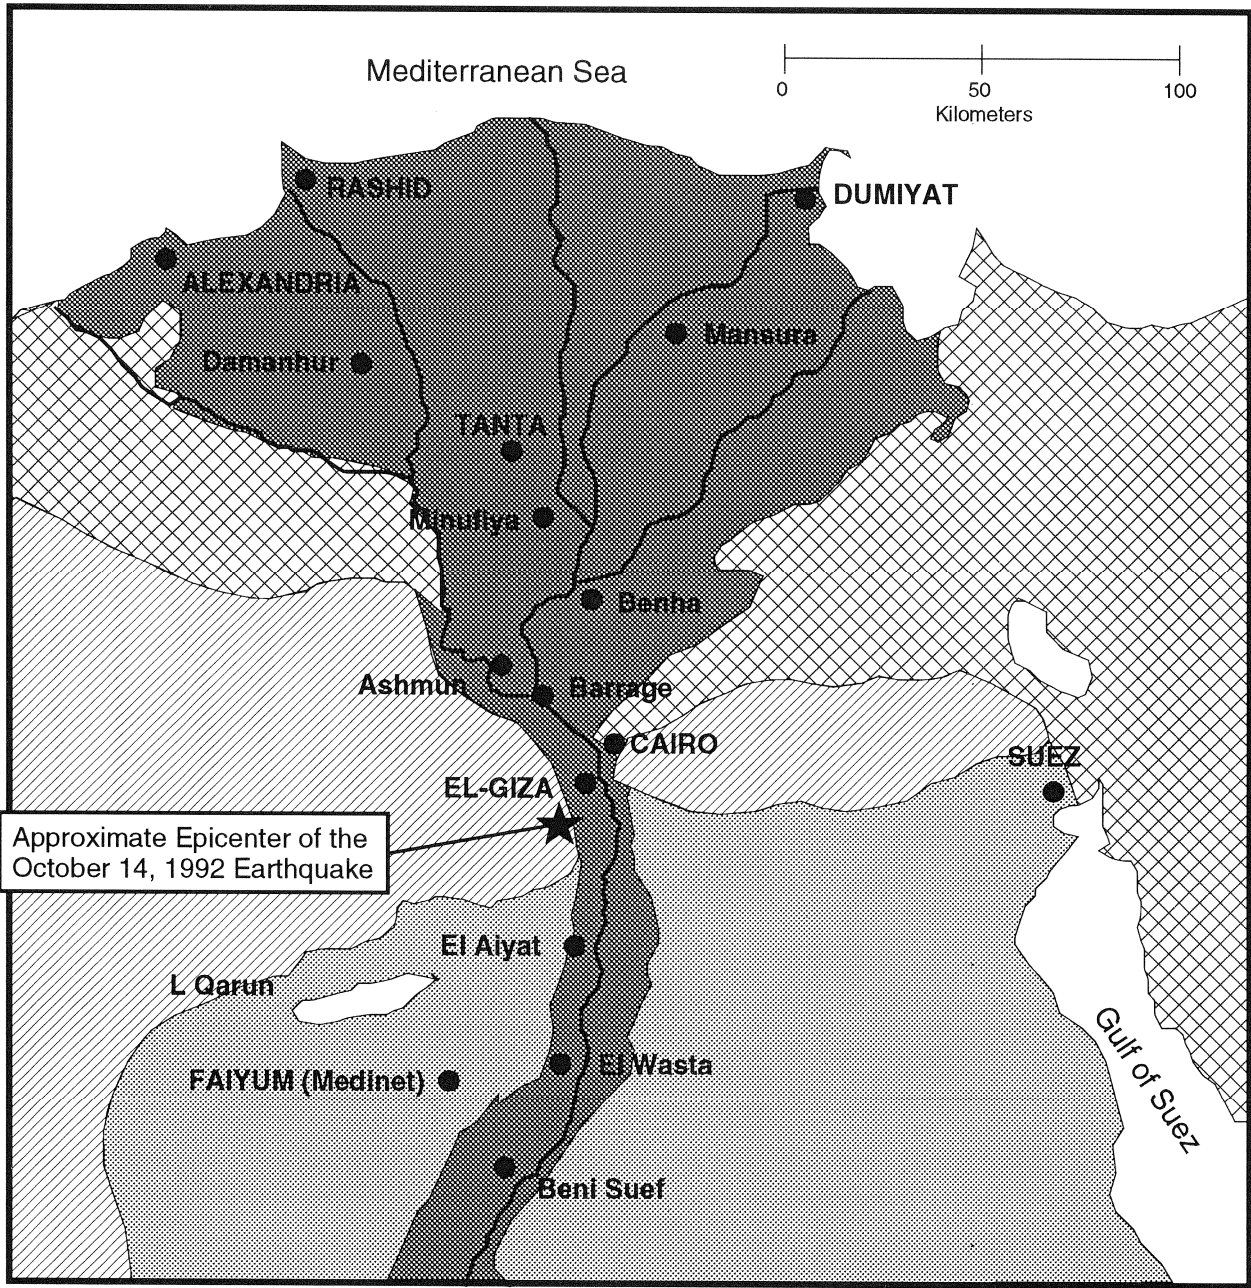

SOILMAP.DRW 90006-23 12/8/92

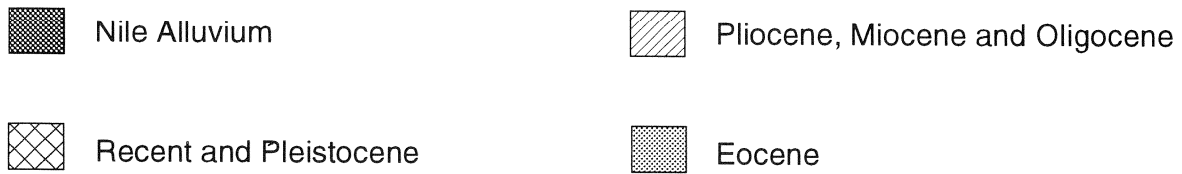


Figure 2-1: Geology map of Cairo and the surrounding area.

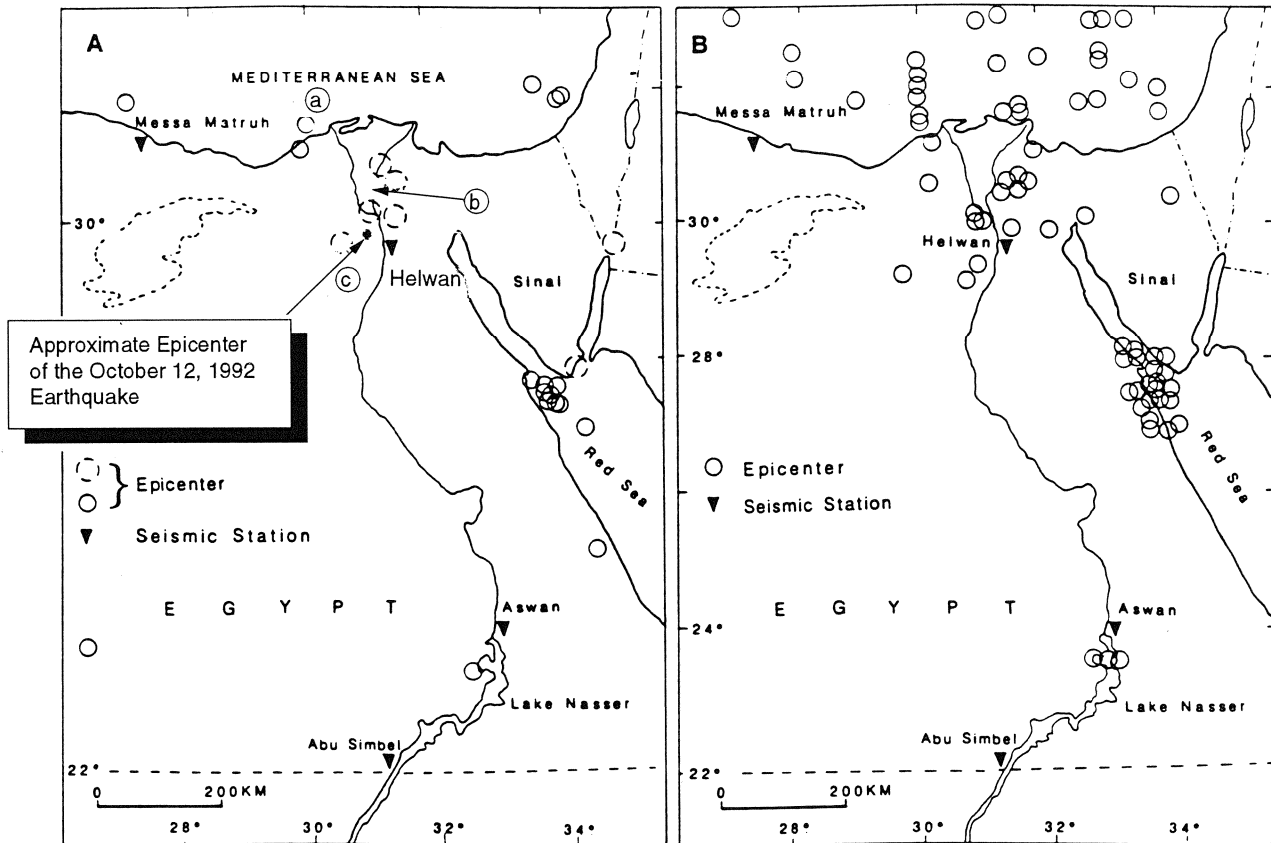


Figure 2-2: (A) Locations of epicenters of historical and recent medium to large earthquakes; (B) Epicenters of small earthquakes (Kebeasy, 1990).

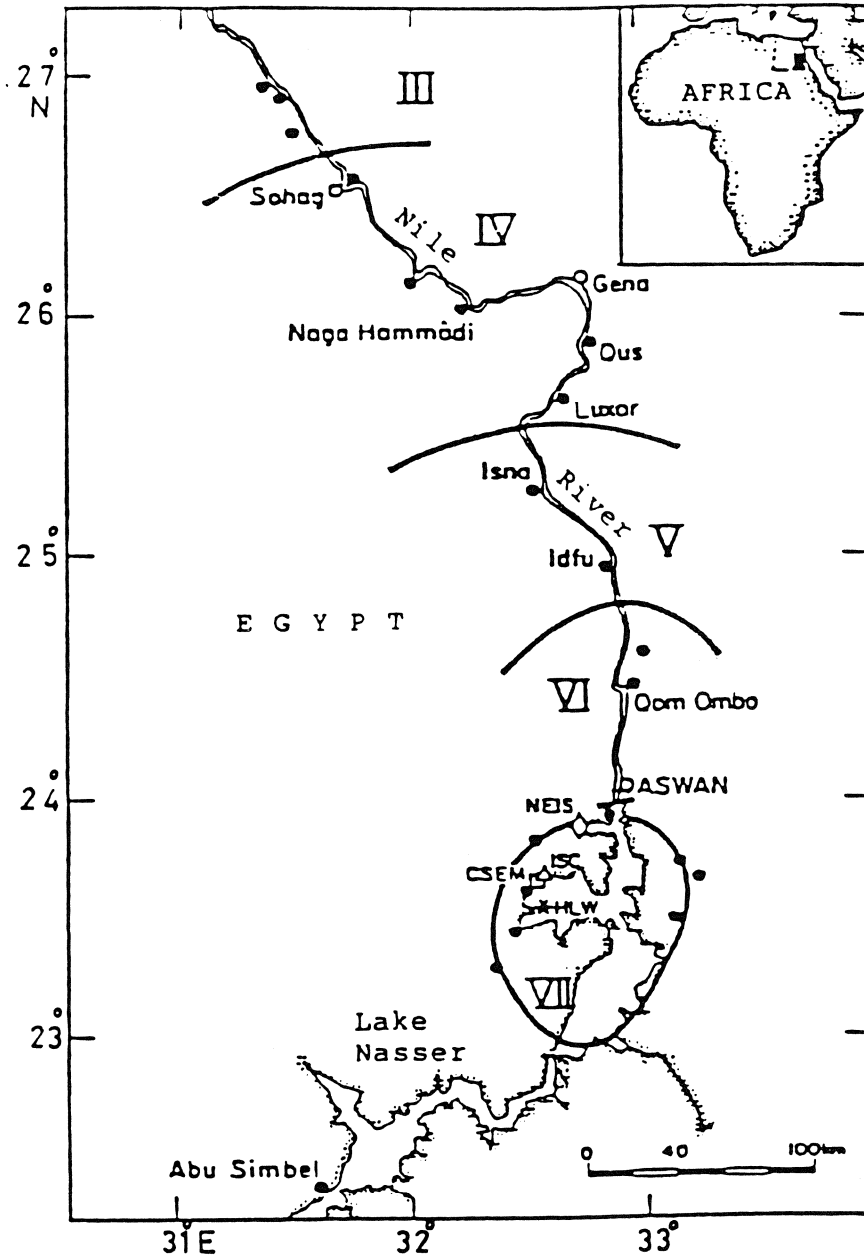


Figure 2-3: Intensity distribution of the 14 November 1981 earthquake as located by HLW = Helwan; NEIS = National Earthquake Information Service (Kebeasy, R.M., M. Maamoun, and E. M. Ibrahim, 1982).

SECTION 3 EXTENT OF DAMAGE

Buildings in Cairo and the surrounding area have been divided into two categories: (1) Nonengineered buildings, and (2) Engineered buildings. Performance, damage, and description of each type of these buildings are discussed in this chapter.

3.1 Nonengineered Buildings

This category of buildings has no seismic resistance and it includes: (a) Unreinforced masonry buildings (brick or stone) with flexible diaphragms (usually wood) or with rigid diaphragms (usually concrete or steel), and (b) adobe type buildings with wood diaphragms.

Unreinforced Masonry (URM) Buildings. In Egypt, buildings with walls of brick and stone masonry have long been regarded as solid construction, providing weather and fire resistance, an attractive appearance, and a general feeling of permanence and solidity. As a result, these materials abound in low- and mid-rise construction throughout older sections of Cairo and the surrounding area.

No surprises were observed in the Oct. 12 event, regarding URM building performance. Numerous collapses and severe damage occurred to such structures throughout the affected area, especially in soft-soil areas (Figure 3-1). Older URM buildings were generally the most damaged structures throughout the area. These buildings were responsible for the great majority of life loss associated with this earthquake. A reported 349 old URM buildings collapsed, and about 7,800 URM buildings were damaged. An estimated 500,000 URM buildings in Egypt are still in use today.


URM buildings experience different types of damage including: (1) Diagonal cracks due to insufficient wall thickness and the presence of big openings (Figure 3-1a), (2) Lack of lateral support resulted in serious damage or collapse of walls or parapets (Figure 3-1), (3) Lack of adequate anchorage in the wall diaphragm connection resulted in horizontal cracks between the wall and



Diagonal cracks
due to insufficient
wall thickness and
big openings



Figure 3-1a: Damage to unreinforced masonry buildings.

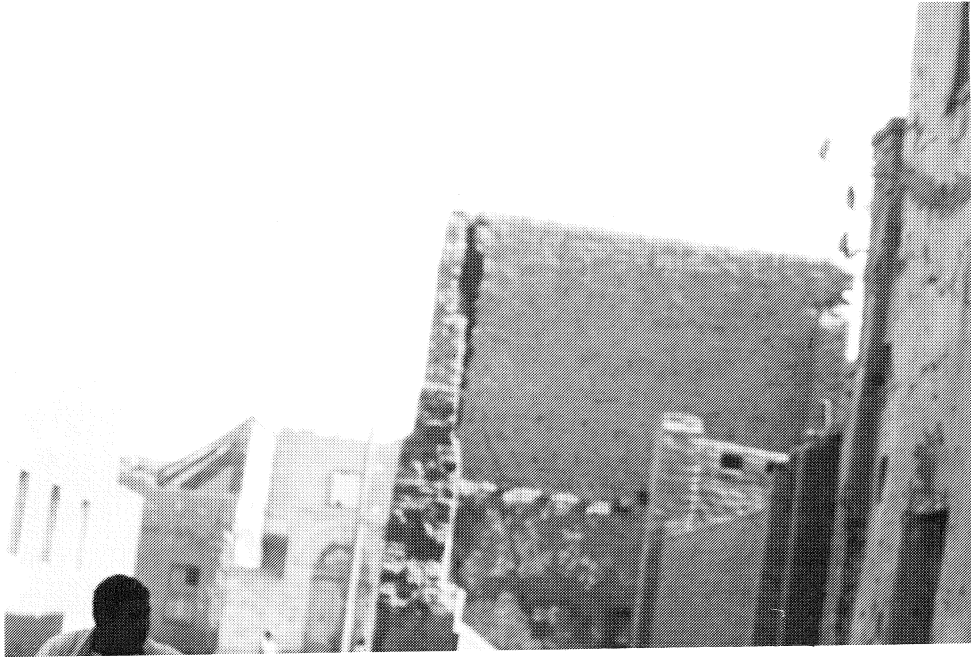

Damage to laterally unsupported walls and vertical cracks at wall connections due to lack of adequate anchorage.



Figure 3-1b: Damage to unreinforced masonry buildings.

the diaphragms, and (4) Lack of adequate anchorage between walls resulted in vertical cracks and separation in the corners at the connection between the walls (Figure 3-1b). Buildings with adequate anchorage in terms of tie-beams did not experience this type of crack.

Monuments. More than 150 monuments throughout Egypt were damaged during the Cairo Earthquake. Ancient Islamic sites in Cairo were seriously damaged. Damage included damage to mosques minarets, cracks at wall connections and wall diaphragm connections, and damage to unsupported parapets. The Valley of the Kings, the burial site of Tutankhamen, and Queen Hatshepsut's temple at Deir el-Bahri in the south, which dates from the 15th century B.C., sustained some cracking. Other well-known tourist attractions that were cracked include the Oracle Temple at Siwa Oasis near Libya, Luxor Temple, and Ramses II's mortuary temple opposite Luxor on the west bank of the Nile River.

3.2 Engineered Buildings

This category of buildings include (1) Reinforced concrete buildings with unreinforced masonry infill walls, (2) Reinforced concrete shear wall buildings, and (3) moment resisting concrete frame or steel frame buildings.

In general, buildings in this category performed well during the October 12, Cairo earthquake. Damage to these type of buildings was due to special conditions, including soft stories, building irregularity, bounding, inadequate detailing, and poor construction materials and workmanship. Examples of these types of damage are discussed below.

Nonductile concrete buildings represent the majority of larger engineered buildings in Cairo. Most of these buildings have not been designed for earthquakes, however. Ductile detailing in the form of beam stirrups, column hoops, joint reinforcement, and development lengths as required by the *Uniform Building Code* is usually not provided in most of these buildings. A high percentage of these buildings have a *soft story*, which represents a serious seismic hazard.

First Stories (or Soft Stories). The ground floor of a building is frequently the weakest part of the structure. Unlike the upper part of the structure, ground floors are seldom enclosed on all four sides by walls capable of resisting shear (or lateral earthquake-induced) forces. Ground floors are also generally taller than upper floors. Ground-floor shops, stores, lobbies, or garages normally allot most of their front wall area to doors or plate glass, leaving one side of the building with no shear resistance. Bending and shear forces induced by strong ground shaking are therefore concentrated in the ground-floor columns. The lack of ductile detailing usually contributes significantly to failure of this soft story.

Among the most catastrophic collapses was the 14-story nonductile concrete building in suburban Heliopolis (about 25 km from the epicenter) where an estimated 61 people were killed (Figure 3-2). It was the only multistory building failure or *pancake* collapse in Cairo. This building was of nonductile concrete construction with a soft story (the building was built about 1986), and had a water tank on the roof (about 30 cubic meters of water). It appears that excessive deflection of the building caused collapse as column-beam connections failed. As collapse began, the impact load of each floor slab striking the ground or the floor below added to the overload and culminated in total collapse. Inspection of the concrete indicated that it was of poor quality. Nondeformed bars were used in this building, which contributed to the low bond between the steel and concrete.

High-rise Buildings. In general, high-rise buildings in Cairo performed well during the earthquake. Most high-rise buildings are located on both sides of the Nile River. Figure 3-3 shows a set of concrete towers (in the City of Maadi about 15 km from the epicenter) that are 42 stories high. Each tower is supported on 36 concrete columns on a pile foundation about 25 meters deep. These towers performed well during the earthquake, only sustaining nonstructural damage as shown in Figure 3-3.

Figure 3-4 shows nonstructural horizontal cracks in a 14-story concrete building, and Figure 3-5 shows a 30-story concrete shear wall building, both in the city of Maadi. The 30-story building has an irregular, staircase shape and sustained a vertical crack (about 2 centimeters wide, between the concrete shear wall and the URM infill wall) at the corner of the third step, as shown in Figure 3-5.



Figure 3-2: Collapse of a 14-story concrete-frame building.

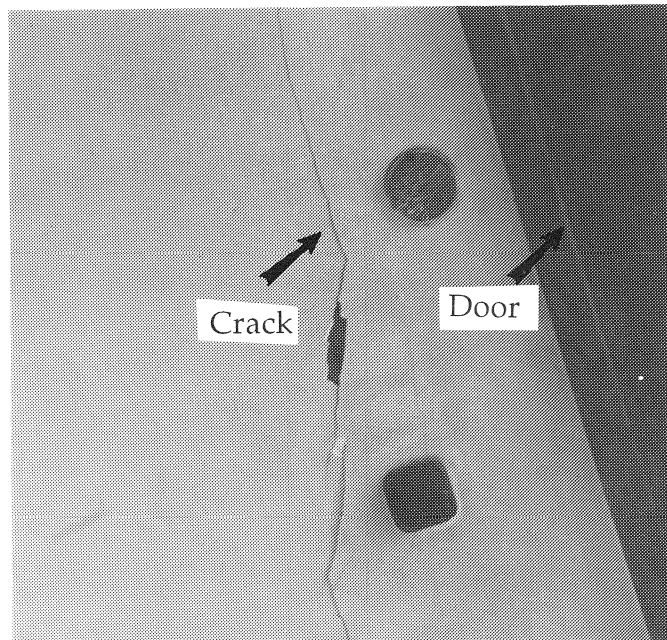
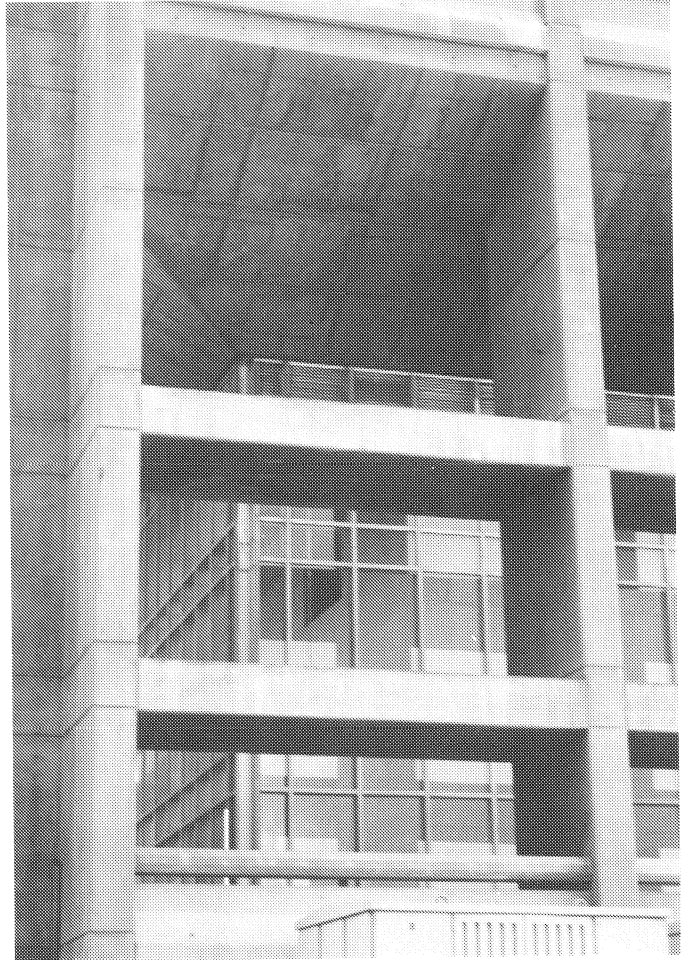
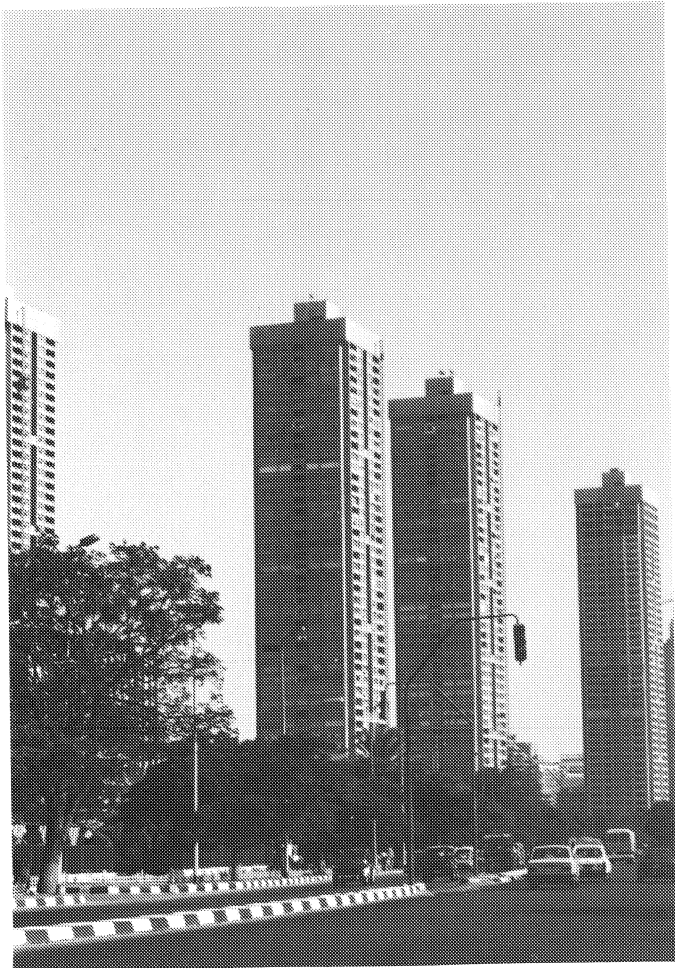


Figure 3-3: 42-story high-rise concrete buildings in Cairo experienced only nonstructural damage.



Figure 3-4: Nonstructural horizontal cracks in a 14-story concrete-frame building.



Figure 3-5: Vertical crack in a 36-story shear wall concrete building due to building irregularity.

Cairo Tower (Figure 3-6), a 30-year-old, 200-meter-high, cylindrical concrete structure with a 60-meter-deep foundation, sustained no damage from the earthquake. A restaurant located at the top of this building sustained various types of nonstructural damage.

Figure 3-7 shows a new, 30-story cylindrical hotel (about 20 km from the epicenter). The first three stories of the building are concrete, and the remaining 27 stories are of moment steel frame. The building is supported on wedge columns as shown in Figure 3-7 and sustained only nonstructural damage from the earthquake.

Pounding. Building pounding caused damage--some structural distress but not collapse--in a number of locations. Typical damage caused by pounding is shown in Figure 3-8. The tall building on the left pounded against the shorter building, resulting in damage to the corner column and beams of the shorter building.

Public School Buildings. Public school buildings were severely damaged during the Cairo Earthquake. About 100 school buildings collapsed, and about 950 school buildings were damaged and need repair. Most of the damaged buildings are old URM buildings on soft soil. Similar schools on good soil had only minor or no damage from the earthquake.

Hospitals. Most, if not all, hospital buildings lacked seismic design, but still performed well in the earthquake. A few sustained architectural damage, but there were no operational interruptions. Figure 3-9 shows a five-story hospital building (in the city of Maadi about 15 km from the epicenter) of reinforced concrete moment frame with URM infill. This building had very minor nonstructural damage from the earthquake.

3.3 Lifelines

Transportation

Road and Bridges. Roads and bridges performed well during and after the earthquake. Lateral spreading caused about 300 meters of the main road between Cairo and Asiot (near the village of El-Aiyat) (Figure 3-10), which is

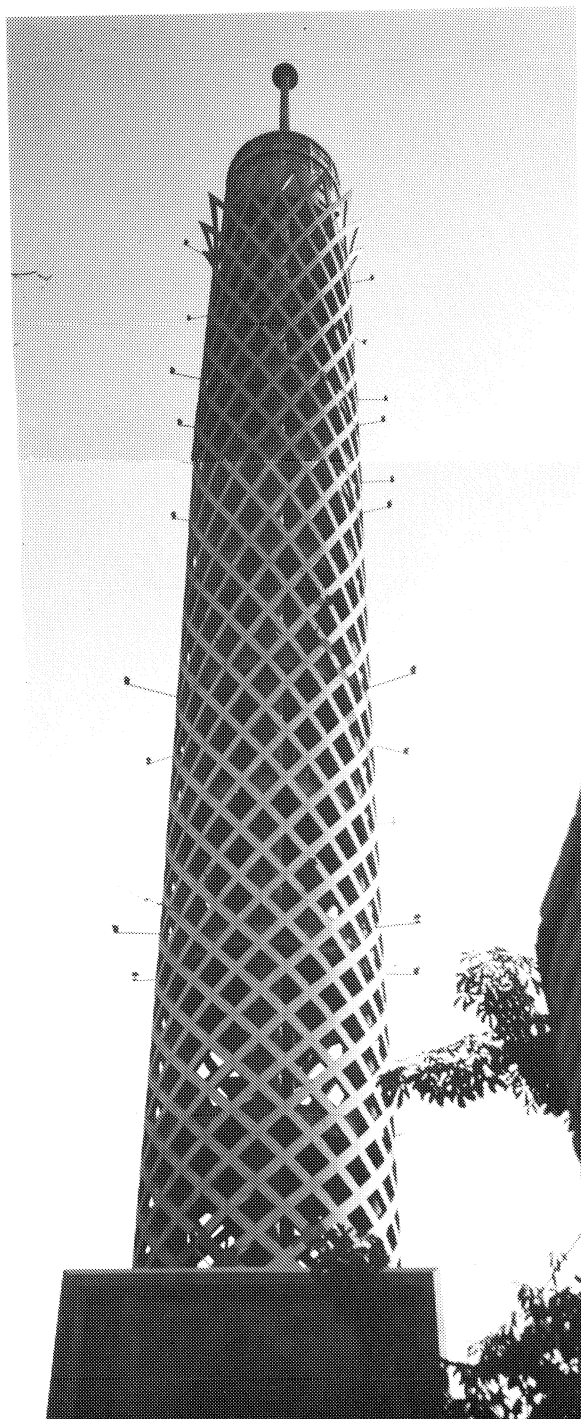


Figure 3-6: The tallest structure in Cairo (Cairo Tower) sustained only nonstructural damage.



Figure 3-7: 30-story cylindrical hotel sustained only nonstructural damage.

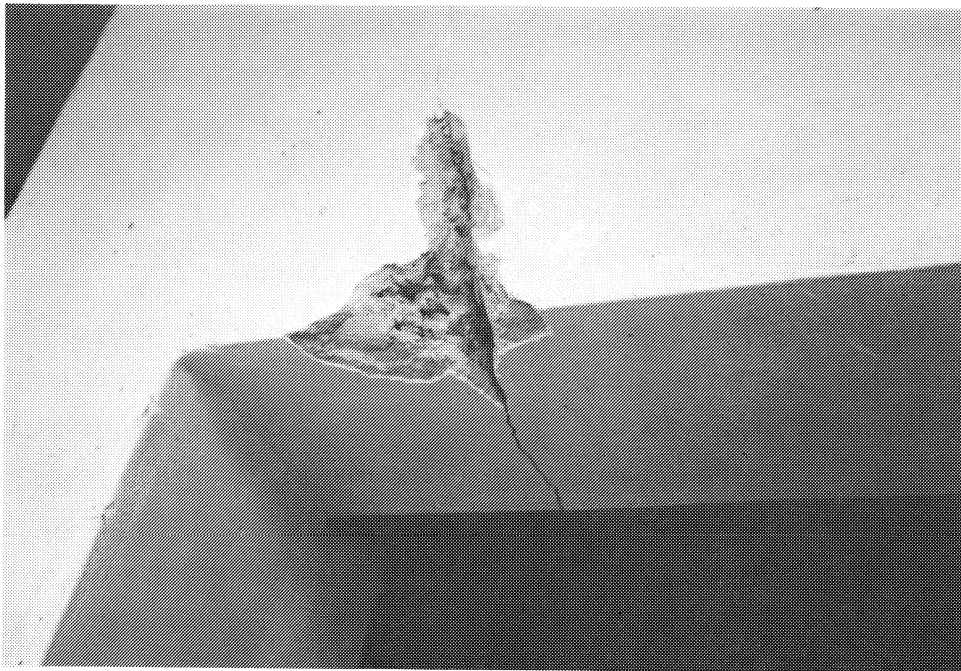


Figure 3-8: Structural damage caused by pounding.

known as "agriculture road," to settle about 0.5 meter. The road is parallel to the Nile River, which is about 100 meters away.

There are eight bridges across the Nile River in Cairo, connecting the east and west sides of Cairo. A steel girder bridge with a concrete deck, known as Kasr El-Nile Bridge (which is more than 60 years old and one of the oldest bridges on the Nile), had minor damage to the concrete deck during the earthquake. The center part of this bridge, as shown in Figure 3-11, can be rotated to allow big ships to go through the Nile. This part of the bridge acts as a double cantilever, and a section of about 1 by 0.5 meter of the concrete deck at the end of the eastern part of this cantilever fell down. It was noted that a small part of the concrete had been broken before the earthquake. Traffic on the bridge was reduced while the broken deck was replaced, and was back to normal two days after the earthquake.

Railroads. The underground system in Cairo, "the Metro," performed well during the earthquake and sustained no damage. Operation was not interrupted during or after the earthquake. There was no reported damage to the main railroad system which connect Cairo with other cities.

Airports. Cairo's international airport (about 30 km from the epicenter) performed well during the earthquake, and there was no reported damage to airport structures or contents. Operation of the airport was not interrupted during or after the earthquake.

Water and Sewage Systems

In general, the water and sewage systems performed well during the earthquake. There was no reported damage to underground piping or treatment plants. An elevated tank of about 5,000 cubic meters and about 30 meters above ground (Figure 3-12) in the city of Giza had some damage in the roofing system. The tank is supported by 64 columns (25 by 100 centimeters). The roofing system has a skylight supported by posts (15-by-15-centimeter concrete columns), about 2 meters high. Four of these posts were damaged, and there were some cracks in the roof.



Figure 3-9: A 5-story concrete-frame hospital sustained only nonstructural damage.



Figure 3-10: A main road between Cairo and Asiot settled about 0.5 meters due to lateral spreading.



Figure 3-11: An old steel girder bridge with concrete deck lost part of the concrete deck.



Figure 3-12: The roofing system of this elevated water tank in the City of Giza was damaged during the earthquake.

Electric System

The primary source of power generation in Cairo is hydroelectric plants located at the High Dam (about 750 km from the epicenter). Long-distance transmission is by a system of 500-kilovolt lines and primary substations. Primary substations step power down to 230, 115, and 69 kilovolts for local transmission.

Experience from past earthquakes has shown that high-voltage substations are normally the weak link in earthquakes. The tall ceramic columns on high-voltage switchyard equipment have a tendency for brittle fracture and collapse. Additional problems are caused by the interaction of ceramic columns through rigid busbar connections, or by loads imposed on ceramic columns by *cable whip* from overhead lines.

The electric system in Cairo performed well during the earthquake. For most of Cairo, electricity was not lost during or after the earthquake. Some villages around Cairo lost power for few hours. A 115-kilovolt substation a few kilometers from the village of El-Aiyat had very minor ceramic damage. (Author's personal observation.)

Telecommunication System

In general, the telephone system performed well during and after the earthquake. The flood of calls that normally follow an earthquake immediately overloaded the system. Some private phone lines were temporarily blocked in order to free access to emergency lines such as hospitals, fire stations, or police headquarters. Some batteries fell off their racks in the Local Exchange Carrier (LEC) and Inter Exchange Carrier (IEC) telephone switching centers in Cairo, which caused loss of telephone lines in some areas of Cairo. (Personal communications, Telephone Company employees.)

SECTION 4

SUMMARY AND CONCLUSIONS

1. This earthquake demonstrated the need to increase education, awareness, and preparedness at all levels of government and the private sector. Mitigation programs should be accelerated to include preparedness planning, response and recovery planning, engineering vulnerability studies, and retrofit of hazardous buildings and structures.
2. The primary cause of death was the lack of education and awareness about earthquakes combined with the collapse of URM buildings and the high-rise concrete building in Cairo.
3. The quality of construction in Cairo is poor and clearly contributed to the number of collapses. This problem is not unique to Egypt. To ensure that a structure is properly constructed and will perform as designed, it is necessary to assure adequate quality, by having the design engineer perform inspections during the construction process.
4. Concrete-frame structures, one of the most popular types of design construction, caused about 10% of the deaths in the Cairo Earthquake. The technology to build safe concrete-frame structures and strengthen existing ones is well developed and can be applied by knowledgeable and skilled engineers. However, all too frequently, inadequately designed structures are built. The cost to strengthen existing concrete-frame buildings can be significant. It is far more cost-effective to implement a seismic quality control program during design and construction. The seismic performance of reinforced concrete frames is significantly affected by many factors. One of these is proper design and detailing to ensure a ductile (flexible) system. Such a system is a more heavily reinforced concrete frame that is capable of undergoing larger deformations without failure. Concrete-frame buildings often have infill walls of concrete block or other masonry, which may or may

not be designed as structural elements. If infill walls (which must be reinforced) are designed as nonstructural elements, it is necessary to allow for movements of the frame relative to by the infill walls.

5. In general, the newer buildings performed well; however, this earthquake did not provide the severe ground motions to adequately test them.
6. Poor performance of old buildings was due to the use of brittle construction materials, inadequate design and detailing, lack of maintenance, or deficiency in workmanship. In many cases, all these factors were present in a single structure.
7. URM buildings once again proved to be the most hazardous form of building construction. The presence of rigid diaphragms appeared to reduce the probability of total collapse of the structures.
8. Strong motion instrumentation is needed in Egypt.

SECTION 5 REFERENCES

- Ambraseys, N. N. 1961. "On the Seismicity of Southwest Asia (from XV Century Arabic Manuscript)." *Rev. pour l'Etude des Calamites (Geneva)*, 37.
- Ibrahim, E. M., & I. Marzouk. 1979. Seismotectonic Study of Egypt. Bull. *Helwan Inst. Astronom. Geophys.* 191 pp.
- Karnik, V. 1969. *Seismicity of Europe, parts I and II*. Academic Publishing House, Czechoslovakia Acad. Sci., Prague.
- Kebeasy, R. M. 1990. "Seismicity of Egypt." Helwan Institute of Astronomy and Geophysics, Egypt.
- Kebeasy, R. M., M. Maamoun, and E. M. Ibrahim. 1982. "Induced Earthquakes and Seismotectonics of Lake Nasser, Egypt." Abstract, EOS Transactions, American Geophysical Union. Vol. 63, No. 5, p. 1267.
- Maamoun, M. E. 1979. "Macroseismic Observations of Principal Earthquakes in Egypt." Helwan Institute of Astronomy and Geophysics, Bulletin 183. Egypt.
- Maamoun, M. E., and H. M. Kashab. 1978. "Seismic Studies of the Shadwan (Red Sea) Earthquake." Helwan Institute of Astronomy and Geophysics, Bulletin 171. Egypt.
- Poirier, J. P. & M. A. Taher. 1980. Historical Seismicity in the Near and Middle East, North Africa and Spain from Arabic Documents (7th-8th centuries). *Bull. Seism. Soc. Am.* 70:2185-2201.
- Savage, W. 1984. Evaluation of Regional Seismicity. Woodward and Clyde Consultants, Internal Report to Aswan High Dam Authority (unpublished).
- Sieberg, A. 1932. *Erdbebengeographie*. Handbuch der Geophysik, Bd IV, Berlin.

Topozada, T. R., F. K. Boulos, S. F. Henin, A. A. El Sherif, A. A. El Sayed, N. Z. Basta, F. A. Shatiya, Y. S. Melik, C. H. Cramer, and D. L. Parke. 1984. "Seismicity near Aswan High Dam, Egypt, Following the November 1981 Earthquake." *Annals of the Geophysical Survey of Egypt*. Vol. XIV, 1984, Published 1988.

**NATIONAL CENTER FOR EARTHQUAKE ENGINEERING RESEARCH
LIST OF TECHNICAL REPORTS**

The National Center for Earthquake Engineering Research (NCEER) publishes technical reports on a variety of subjects related to earthquake engineering written by authors funded through NCEER. These reports are available from both NCEER's Publications Department and the National Technical Information Service (NTIS). Requests for reports should be directed to the Publications Department, National Center for Earthquake Engineering Research, State University of New York at Buffalo, Red Jacket Quadrangle, Buffalo, New York 14261. Reports can also be requested through NTIS, 5285 Port Royal Road, Springfield, Virginia 22161. NTIS accession numbers are shown in parenthesis, if available.

- NCEER-87-0001 "First-Year Program in Research, Education and Technology Transfer," 3/5/87, (PB88-134275/AS).
- NCEER-87-0002 "Experimental Evaluation of Instantaneous Optimal Algorithms for Structural Control," by R.C. Lin, T.T. Soong and A.M. Reinhorn, 4/20/87, (PB88-134341/AS).
- NCEER-87-0003 "Experimentation Using the Earthquake Simulation Facilities at University at Buffalo," by A.M. Reinhorn and R.L. Ketter, to be published.
- NCEER-87-0004 "The System Characteristics and Performance of a Shaking Table," by J.S. Hwang, K.C. Chang and G.C. Lee, 6/1/87, (PB88-134259/AS). This report is available only through NTIS (see address given above).
- NCEER-87-0005 "A Finite Element Formulation for Nonlinear Viscoplastic Material Using a Q Model," by O. Gyebi and G. Dasgupta, 11/2/87, (PB88-213764/AS).
- NCEER-87-0006 "Symbolic Manipulation Program (SMP) - Algebraic Codes for Two and Three Dimensional Finite Element Formulations," by X. Lee and G. Dasgupta, 11/9/87, (PB88-219522/AS).
- NCEER-87-0007 "Instantaneous Optimal Control Laws for Tall Buildings Under Seismic Excitations," by J.N. Yang, A. Akbarpour and P. Ghaemmaghami, 6/10/87, (PB88-134333/AS).
- NCEER-87-0008 "IDARC: Inelastic Damage Analysis of Reinforced Concrete Frame - Shear-Wall Structures," by Y.J. Park, A.M. Reinhorn and S.K. Kunnath, 7/20/87, (PB88-134325/AS).
- NCEER-87-0009 "Liquefaction Potential for New York State: A Preliminary Report on Sites in Manhattan and Buffalo," by M. Budhu, V. Vijayakumar, R.F. Giese and L. Baumgras, 8/31/87, (PB88-163704/AS). This report is available only through NTIS (see address given above).
- NCEER-87-0010 "Vertical and Torsional Vibration of Foundations in Inhomogeneous Media," by A.S. Veletsos and K.W. Dotson, 6/1/87, (PB88-134291/AS).
- NCEER-87-0011 "Seismic Probabilistic Risk Assessment and Seismic Margins Studies for Nuclear Power Plants," by Howard H.M. Hwang, 6/15/87, (PB88-134267/AS).
- NCEER-87-0012 "Parametric Studies of Frequency Response of Secondary Systems Under Ground-Acceleration Excitations," by Y. Yong and Y.K. Lin, 6/10/87, (PB88-134309/AS).
- NCEER-87-0013 "Frequency Response of Secondary Systems Under Seismic Excitation," by J.A. HoLung, J. Cai and Y.K. Lin, 7/31/87, (PB88-134317/AS).
- NCEER-87-0014 "Modelling Earthquake Ground Motions in Seismically Active Regions Using Parametric Time Series Methods," by G.W. Ellis and A.S. Cakmak, 8/25/87, (PB88-134283/AS).
- NCEER-87-0015 "Detection and Assessment of Seismic Structural Damage," by E. DiPasquale and A.S. Cakmak, 8/25/87, (PB88-163712/AS).

- NCEER-87-0016 "Pipeline Experiment at Parkfield, California," by J. Isenberg and E. Richardson, 9/15/87, (PB88-163720/AS). This report is available only through NTIS (see address given above).
- NCEER-87-0017 "Digital Simulation of Seismic Ground Motion," by M. Shinozuka, G. Deodatis and T. Harada, 8/31/87, (PB88-155197/AS). This report is available only through NTIS (see address given above).
- NCEER-87-0018 "Practical Considerations for Structural Control: System Uncertainty, System Time Delay and Truncation of Small Control Forces," J.N. Yang and A. Akbarpour, 8/10/87, (PB88-163738/AS).
- NCEER-87-0019 "Modal Analysis of Nonclassically Damped Structural Systems Using Canonical Transformation," by J.N. Yang, S. Sarkani and F.X. Long, 9/27/87, (PB88-187851/AS).
- NCEER-87-0020 "A Nonstationary Solution in Random Vibration Theory," by J.R. Red-Horse and P.D. Spanos, 11/3/87, (PB88-163746/AS).
- NCEER-87-0021 "Horizontal Impedances for Radially Inhomogeneous Viscoelastic Soil Layers," by A.S. Veletsos and K.W. Dotson, 10/15/87, (PB88-150859/AS).
- NCEER-87-0022 "Seismic Damage Assessment of Reinforced Concrete Members," by Y.S. Chung, C. Meyer and M. Shinozuka, 10/9/87, (PB88-150867/AS). This report is available only through NTIS (see address given above).
- NCEER-87-0023 "Active Structural Control in Civil Engineering," by T.T. Soong, 11/11/87, (PB88-187778/AS).
- NCEER-87-0024 "Vertical and Torsional Impedances for Radially Inhomogeneous Viscoelastic Soil Layers," by K.W. Dotson and A.S. Veletsos, 12/87, (PB88-187786/AS).
- NCEER-87-0025 "Proceedings from the Symposium on Seismic Hazards, Ground Motions, Soil-Liquefaction and Engineering Practice in Eastern North America," October 20-22, 1987, edited by K.H. Jacob, 12/87, (PB88-188115/AS).
- NCEER-87-0026 "Report on the Whittier-Narrows, California, Earthquake of October 1, 1987," by J. Pantelic and A. Reinhorn, 11/87, (PB88-187752/AS). This report is available only through NTIS (see address given above).
- NCEER-87-0027 "Design of a Modular Program for Transient Nonlinear Analysis of Large 3-D Building Structures," by S. Srivastav and J.F. Abel, 12/30/87, (PB88-187950/AS).
- NCEER-87-0028 "Second-Year Program in Research, Education and Technology Transfer," 3/8/88, (PB88-219480/AS).
- NCEER-88-0001 "Workshop on Seismic Computer Analysis and Design of Buildings With Interactive Graphics," by W. McGuire, J.F. Abel and C.H. Conley, 1/18/88, (PB88-187760/AS).
- NCEER-88-0002 "Optimal Control of Nonlinear Flexible Structures," by J.N. Yang, F.X. Long and D. Wong, 1/22/88, (PB88-213772/AS).
- NCEER-88-0003 "Substructuring Techniques in the Time Domain for Primary-Secondary Structural Systems," by G.D. Manolis and G. Juhn, 2/10/88, (PB88-213780/AS).
- NCEER-88-0004 "Iterative Seismic Analysis of Primary-Secondary Systems," by A. Singhal, L.D. Lutes and P.D. Spanos, 2/23/88, (PB88-213798/AS).
- NCEER-88-0005 "Stochastic Finite Element Expansion for Random Media," by P.D. Spanos and R. Ghanem, 3/14/88, (PB88-213806/AS).

- NCEER-88-0006 "Combining Structural Optimization and Structural Control," by F.Y. Cheng and C.P. Pantelides, 1/10/88, (PB88-213814/AS).
- NCEER-88-0007 "Seismic Performance Assessment of Code-Designed Structures," by H.H-M. Hwang, J-W. Jaw and H-J. Shau, 3/20/88, (PB88-219423/AS).
- NCEER-88-0008 "Reliability Analysis of Code-Designed Structures Under Natural Hazards," by H.H-M. Hwang, H. Ushiba and M. Shinozuka, 2/29/88, (PB88-229471/AS).
- NCEER-88-0009 "Seismic Fragility Analysis of Shear Wall Structures," by J-W Jaw and H.H-M. Hwang, 4/30/88, (PB89-102867/AS).
- NCEER-88-0010 "Base Isolation of a Multi-Story Building Under a Harmonic Ground Motion - A Comparison of Performances of Various Systems," by F-G Fan, G. Ahmadi and I.G. Tadjbakhsh, 5/18/88, (PB89-122238/AS).
- NCEER-88-0011 "Seismic Floor Response Spectra for a Combined System by Green's Functions," by F.M. Lavelle, L.A. Bergman and P.D. Spanos, 5/1/88, (PB89-102875/AS).
- NCEER-88-0012 "A New Solution Technique for Randomly Excited Hysteretic Structures," by G.Q. Cai and Y.K. Lin, 5/16/88, (PB89-102883/AS).
- NCEER-88-0013 "A Study of Radiation Damping and Soil-Structure Interaction Effects in the Centrifuge," by K. Weissman, supervised by J.H. Prevost, 5/24/88, (PB89-144703/AS).
- NCEER-88-0014 "Parameter Identification and Implementation of a Kinematic Plasticity Model for Frictional Soils," by J.H. Prevost and D.V. Griffiths, to be published.
- NCEER-88-0015 "Two- and Three- Dimensional Dynamic Finite Element Analyses of the Long Valley Dam," by D.V. Griffiths and J.H. Prevost, 6/17/88, (PB89-144711/AS).
- NCEER-88-0016 "Damage Assessment of Reinforced Concrete Structures in Eastern United States," by A.M. Reinhorn, M.J. Seidel, S.K. Kunnath and Y.J. Park, 6/15/88, (PB89-122220/AS).
- NCEER-88-0017 "Dynamic Compliance of Vertically Loaded Strip Foundations in Multilayered Viscoelastic Soils," by S. Ahmad and A.S.M. Israil, 6/17/88, (PB89-102891/AS).
- NCEER-88-0018 "An Experimental Study of Seismic Structural Response With Added Viscoelastic Dampers," by R.C. Lin, Z. Liang, T.T. Soong and R.H. Zhang, 6/30/88, (PB89-122212/AS). This report is available only through NTIS (see address given above).
- NCEER-88-0019 "Experimental Investigation of Primary - Secondary System Interaction," by G.D. Manolis, G. Juhn and A.M. Reinhorn, 5/27/88, (PB89-122204/AS).
- NCEER-88-0020 "A Response Spectrum Approach For Analysis of Nonclassically Damped Structures," by J.N. Yang, S. Sarkani and F.X. Long, 4/22/88, (PB89-102909/AS).
- NCEER-88-0021 "Seismic Interaction of Structures and Soils: Stochastic Approach," by A.S. Veletsos and A.M. Prasad, 7/21/88, (PB89-122196/AS).
- NCEER-88-0022 "Identification of the Serviceability Limit State and Detection of Seismic Structural Damage," by E. DiPasquale and A.S. Cakmak, 6/15/88, (PB89-122188/AS). This report is available only through NTIS (see address given above).
- NCEER-88-0023 "Multi-Hazard Risk Analysis: Case of a Simple Offshore Structure," by B.K. Bhartia and E.H. Vanmarcke, 7/21/88, (PB89-145213/AS).

- NCEER-88-0024 "Automated Seismic Design of Reinforced Concrete Buildings," by Y.S. Chung, C. Meyer and M. Shinozuka, 7/5/88, (PB89-122170/AS). This report is available only through NTIS (see address given above).
- NCEER-88-0025 "Experimental Study of Active Control of MDOF Structures Under Seismic Excitations," by L.L. Chung, R.C. Lin, T.T. Soong and A.M. Reinhorn, 7/10/88, (PB89-122600/AS).
- NCEER-88-0026 "Earthquake Simulation Tests of a Low-Rise Metal Structure," by J.S. Hwang, K.C. Chang, G.C. Lee and R.L. Ketter, 8/1/88, (PB89-102917/AS).
- NCEER-88-0027 "Systems Study of Urban Response and Reconstruction Due to Catastrophic Earthquakes," by F. Kozin and H.K. Zhou, 9/22/88, (PB90-162348/AS).
- NCEER-88-0028 "Seismic Fragility Analysis of Plane Frame Structures," by H.H-M. Hwang and Y.K. Low, 7/31/88, (PB89-131445/AS).
- NCEER-88-0029 "Response Analysis of Stochastic Structures," by A. Kardara, C. Bucher and M. Shinozuka, 9/22/88, (PB89-174429/AS).
- NCEER-88-0030 "Nonnormal Accelerations Due to Yielding in a Primary Structure," by D.C.K. Chen and L.D. Lutes, 9/19/88, (PB89-131437/AS).
- NCEER-88-0031 "Design Approaches for Soil-Structure Interaction," by A.S. Veletsos, A.M. Prasad and Y. Tang, 12/30/88, (PB89-174437/AS). This report is available only through NTIS (see address given above).
- NCEER-88-0032 "A Re-evaluation of Design Spectra for Seismic Damage Control," by C.J. Turkstra and A.G. Tallin, 11/7/88, (PB89-145221/AS).
- NCEER-88-0033 "The Behavior and Design of Noncontact Lap Splices Subjected to Repeated Inelastic Tensile Loading," by V.E. Sagan, P. Gergely and R.N. White, 12/8/88, (PB89-163737/AS).
- NCEER-88-0034 "Seismic Response of Pile Foundations," by S.M. Mamoon, P.K. Banerjee and S. Ahmad, 11/1/88, (PB89-145239/AS).
- NCEER-88-0035 "Modeling of R/C Building Structures With Flexible Floor Diaphragms (IDARC2)," by A.M. Reinhorn, S.K. Kunnath and N. Panahshahi, 9/7/88, (PB89-207153/AS).
- NCEER-88-0036 "Solution of the Dam-Reservoir Interaction Problem Using a Combination of FEM, BEM with Particular Integrals, Modal Analysis, and Substructuring," by C-S. Tsai, G.C. Lee and R.L. Ketter, 12/31/88, (PB89-207146/AS).
- NCEER-88-0037 "Optimal Placement of Actuators for Structural Control," by F.Y. Cheng and C.P. Pantelides, 8/15/88, (PB89-162846/AS).
- NCEER-88-0038 "Teflon Bearings in Aseismic Base Isolation: Experimental Studies and Mathematical Modeling," by A. Mokha, M.C. Constantinou and A.M. Reinhorn, 12/5/88, (PB89-218457/AS). This report is available only through NTIS (see address given above).
- NCEER-88-0039 "Seismic Behavior of Flat Slab High-Rise Buildings in the New York City Area," by P. Weidlinger and M. Ettouney, 10/15/88, (PB90-145681/AS).
- NCEER-88-0040 "Evaluation of the Earthquake Resistance of Existing Buildings in New York City," by P. Weidlinger and M. Ettouney, 10/15/88, to be published.
- NCEER-88-0041 "Small-Scale Modeling Techniques for Reinforced Concrete Structures Subjected to Seismic Loads," by W. Kim, A. El-Attar and R.N. White, 11/22/88, (PB89-189625/AS).

- NCEER-88-0042 "Modeling Strong Ground Motion from Multiple Event Earthquakes," by G.W. Ellis and A.S. Cakmak, 10/15/88, (PB89-174445/AS).
- NCEER-88-0043 "Nonstationary Models of Seismic Ground Acceleration," by M. Grigoriu, S.E. Ruiz and E. Rosenblueth, 7/15/88, (PB89-189617/AS).
- NCEER-88-0044 "SARCF User's Guide: Seismic Analysis of Reinforced Concrete Frames," by Y.S. Chung, C. Meyer and M. Shinozuka, 11/9/88, (PB89-174452/AS).
- NCEER-88-0045 "First Expert Panel Meeting on Disaster Research and Planning," edited by J. Pantelic and J. Stoyale, 9/15/88, (PB89-174460/AS).
- NCEER-88-0046 "Preliminary Studies of the Effect of Degrading Infill Walls on the Nonlinear Seismic Response of Steel Frames," by C.Z. Chrysostomou, P. Gergely and J.F. Abel, 12/19/88, (PB89-208383/AS).
- NCEER-88-0047 "Reinforced Concrete Frame Component Testing Facility - Design, Construction, Instrumentation and Operation," by S.P. Pessiki, C. Conley, T. Bond, P. Gergely and R.N. White, 12/16/88, (PB89-174478/AS).
- NCEER-89-0001 "Effects of Protective Cushion and Soil Compliancy on the Response of Equipment Within a Seismically Excited Building," by J.A. HoLung, 2/16/89, (PB89-207179/AS).
- NCEER-89-0002 "Statistical Evaluation of Response Modification Factors for Reinforced Concrete Structures," by H.H-M. Hwang and J-W. Jaw, 2/17/89, (PB89-207187/AS).
- NCEER-89-0003 "Hysteretic Columns Under Random Excitation," by G-Q. Cai and Y.K. Lin, 1/9/89, (PB89-196513/AS).
- NCEER-89-0004 "Experimental Study of 'Elephant Foot Bulge' Instability of Thin-Walled Metal Tanks," by Z-H. Jia and R.L. Ketter, 2/22/89, (PB89-207195/AS).
- NCEER-89-0005 "Experiment on Performance of Buried Pipelines Across San Andreas Fault," by J. Isenberg, E. Richardson and T.D. O'Rourke, 3/10/89, (PB89-218440/AS).
- NCEER-89-0006 "A Knowledge-Based Approach to Structural Design of Earthquake-Resistant Buildings," by M. Subramani, P. Gergely, C.H. Conley, J.F. Abel and A.H. Zaghaw, 1/15/89, (PB89-218465/AS).
- NCEER-89-0007 "Liquefaction Hazards and Their Effects on Buried Pipelines," by T.D. O'Rourke and P.A. Lane, 2/1/89, (PB89-218481).
- NCEER-89-0008 "Fundamentals of System Identification in Structural Dynamics," by H. Imai, C-B. Yun, O. Maruyama and M. Shinozuka, 1/26/89, (PB89-207211/AS).
- NCEER-89-0009 "Effects of the 1985 Michoacan Earthquake on Water Systems and Other Buried Lifelines in Mexico," by A.G. Ayala and M.J. O'Rourke, 3/8/89, (PB89-207229/AS).
- NCEER-89-R010 "NCEER Bibliography of Earthquake Education Materials," by K.E.K. Ross, Second Revision, 9/1/89, (PB90-125352/AS).
- NCEER-89-0011 "Inelastic Three-Dimensional Response Analysis of Reinforced Concrete Building Structures (IDARC-3D), Part I - Modeling," by S.K. Kunnath and A.M. Reinhorn, 4/17/89, (PB90-114612/AS).
- NCEER-89-0012 "Recommended Modifications to ATC-14," by C.D. Poland and J.O. Malley, 4/12/89, (PB90-108648/AS).
- NCEER-89-0013 "Repair and Strengthening of Beam-to-Column Connections Subjected to Earthquake Loading," by M. Corazao and A.J. Durrani, 2/28/89, (PB90-109885/AS).

- NCEER-89-0014 "Program EXKAL2 for Identification of Structural Dynamic Systems," by O. Maruyama, C-B. Yun, M. Hoshiya and M. Shinozuka, 5/19/89, (PB90-109877/AS).
- NCEER-89-0015 "Response of Frames With Bolted Semi-Rigid Connections, Part I - Experimental Study and Analytical Predictions," by P.J. DiCorso, A.M. Reinhorn, J.R. Dickerson, J.B. Radzimirski and W.L. Harper, 6/1/89, to be published.
- NCEER-89-0016 "ARMA Monte Carlo Simulation in Probabilistic Structural Analysis," by P.D. Spanos and M.P. Mignolet, 7/10/89, (PB90-109893/AS).
- NCEER-89-P017 "Preliminary Proceedings from the Conference on Disaster Preparedness - The Place of Earthquake Education in Our Schools," Edited by K.E.K. Ross, 6/23/89.
- NCEER-89-0017 "Proceedings from the Conference on Disaster Preparedness - The Place of Earthquake Education in Our Schools," Edited by K.E.K. Ross, 12/31/89, (PB90-207895). This report is available only through NTIS (see address given above).
- NCEER-89-0018 "Multidimensional Models of Hysteretic Material Behavior for Vibration Analysis of Shape Memory Energy Absorbing Devices, by E.J. Graesser and F.A. Cozzarelli, 6/7/89, (PB90-164146/AS).
- NCEER-89-0019 "Nonlinear Dynamic Analysis of Three-Dimensional Base Isolated Structures (3D-BASIS)," by S. Nagarajaiah, A.M. Reinhorn and M.C. Constantinou, 8/3/89, (PB90-161936/AS). This report is available only through NTIS (see address given above).
- NCEER-89-0020 "Structural Control Considering Time-Rate of Control Forces and Control Rate Constraints," by F.Y. Cheng and C.P. Pantelides, 8/3/89, (PB90-120445/AS).
- NCEER-89-0021 "Subsurface Conditions of Memphis and Shelby County," by K.W. Ng, T-S. Chang and H-H.M. Hwang, 7/26/89, (PB90-120437/AS).
- NCEER-89-0022 "Seismic Wave Propagation Effects on Straight Jointed Buried Pipelines," by K. Elhmadi and M.J. O'Rourke, 8/24/89, (PB90-162322/AS).
- NCEER-89-0023 "Workshop on Serviceability Analysis of Water Delivery Systems," edited by M. Grigoriu, 3/6/89, (PB90-127424/AS).
- NCEER-89-0024 "Shaking Table Study of a 1/5 Scale Steel Frame Composed of Tapered Members," by K.C. Chang, J.S. Hwang and G.C. Lee, 9/18/89, (PB90-160169/AS).
- NCEER-89-0025 "DYNA1D: A Computer Program for Nonlinear Seismic Site Response Analysis - Technical Documentation," by Jean H. Prevost, 9/14/89, (PB90-161944/AS). This report is available only through NTIS (see address given above).
- NCEER-89-0026 "1:4 Scale Model Studies of Active Tendon Systems and Active Mass Dampers for Aseismic Protection," by A.M. Reinhorn, T.T. Soong, R.C. Lin, Y.P. Yang, Y. Fukao, H. Abe and M. Nakai, 9/15/89, (PB90-173246/AS).
- NCEER-89-0027 "Scattering of Waves by Inclusions in a Nonhomogeneous Elastic Half Space Solved by Boundary Element Methods," by P.K. Hadley, A. Askar and A.S. Cakmak, 6/15/89, (PB90-145699/AS).
- NCEER-89-0028 "Statistical Evaluation of Deflection Amplification Factors for Reinforced Concrete Structures," by H.H.M. Hwang, J-W. Jaw and A.L. Ch'ng, 8/31/89, (PB90-164633/AS).
- NCEER-89-0029 "Bedrock Accelerations in Memphis Area Due to Large New Madrid Earthquakes," by H.H.M. Hwang, C.H.S. Chen and G. Yu, 11/7/89, (PB90-162330/AS).

- NCEER-89-0030 "Seismic Behavior and Response Sensitivity of Secondary Structural Systems," by Y.Q. Chen and T.T. Soong, 10/23/89, (PB90-164658/AS).
- NCEER-89-0031 "Random Vibration and Reliability Analysis of Primary-Secondary Structural Systems," by Y. Ibrahim, M. Grigoriu and T.T. Soong, 11/10/89, (PB90-161951/AS).
- NCEER-89-0032 "Proceedings from the Second U.S. - Japan Workshop on Liquefaction, Large Ground Deformation and Their Effects on Lifelines, September 26-29, 1989," Edited by T.D. O'Rourke and M. Hamada, 12/1/89, (PB90-209388/AS).
- NCEER-89-0033 "Deterministic Model for Seismic Damage Evaluation of Reinforced Concrete Structures," by J.M. Bracci, A.M. Reinhorn, J.B. Mander and S.K. Kunnath, 9/27/89.
- NCEER-89-0034 "On the Relation Between Local and Global Damage Indices," by E. DiPasquale and A.S. Cakmak, 8/15/89, (PB90-173865).
- NCEER-89-0035 "Cyclic Undrained Behavior of Nonplastic and Low Plasticity Silts," by A.J. Walker and H.E. Stewart, 7/26/89, (PB90-183518/AS).
- NCEER-89-0036 "Liquefaction Potential of Surficial Deposits in the City of Buffalo, New York," by M. Budhu, R. Giese and L. Baumgrass, 1/17/89, (PB90-208455/AS).
- NCEER-89-0037 "A Deterministic Assessment of Effects of Ground Motion Incoherence," by A.S. Veletsos and Y. Tang, 7/15/89, (PB90-164294/AS).
- NCEER-89-0038 "Workshop on Ground Motion Parameters for Seismic Hazard Mapping," July 17-18, 1989, edited by R.V. Whitman, 12/1/89, (PB90-173923/AS).
- NCEER-89-0039 "Seismic Effects on Elevated Transit Lines of the New York City Transit Authority," by C.J. Costantino, C.A. Miller and E. Heymsfield, 12/26/89, (PB90-207887/AS).
- NCEER-89-0040 "Centrifugal Modeling of Dynamic Soil-Structure Interaction," by K. Weissman, Supervised by J.H. Prevost, 5/10/89, (PB90-207879/AS).
- NCEER-89-0041 "Linearized Identification of Buildings With Cores for Seismic Vulnerability Assessment," by I-K. Ho and A.E. Aktan, 11/1/89, (PB90-251943/AS).
- NCEER-90-0001 "Geotechnical and Lifeline Aspects of the October 17, 1989 Loma Prieta Earthquake in San Francisco," by T.D. O'Rourke, H.E. Stewart, F.T. Blackburn and T.S. Dickerman, 1/90, (PB90-208596/AS).
- NCEER-90-0002 "Nonnormal Secondary Response Due to Yielding in a Primary Structure," by D.C.K. Chen and L.D. Lutes, 2/28/90, (PB90-251976/AS).
- NCEER-90-0003 "Earthquake Education Materials for Grades K-12," by K.E.K. Ross, 4/16/90, (PB91-113415/AS).
- NCEER-90-0004 "Catalog of Strong Motion Stations in Eastern North America," by R.W. Busby, 4/3/90, (PB90-251984)/AS.
- NCEER-90-0005 "NCEER Strong-Motion Data Base: A User Manual for the GeoBase Release (Version 1.0 for the Sun3)," by P. Friberg and K. Jacob, 3/31/90 (PB90-258062/AS).
- NCEER-90-0006 "Seismic Hazard Along a Crude Oil Pipeline in the Event of an 1811-1812 Type New Madrid Earthquake," by H.H.M. Hwang and C-H.S. Chen, 4/16/90(PB90-258054).
- NCEER-90-0007 "Site-Specific Response Spectra for Memphis Sheahan Pumping Station," by H.H.M. Hwang and C.S. Lee, 5/15/90, (PB91-108811/AS).


- NCEER-90-0008 "Pilot Study on Seismic Vulnerability of Crude Oil Transmission Systems," by T. Ariman, R. Dobry, M. Grigoriu, F. Kozin, M. O'Rourke, T. O'Rourke and M. Shinozuka, 5/25/90, (PB91-108837/AS).
- NCEER-90-0009 "A Program to Generate Site Dependent Time Histories: EQGEN," by G.W. Ellis, M. Srinivasan and A.S. Cakmak, 1/30/90, (PB91-108829/AS).
- NCEER-90-0010 "Active Isolation for Seismic Protection of Operating Rooms," by M.E. Talbott, Supervised by M. Shinozuka, 6/8/9, (PB91-110205/AS).
- NCEER-90-0011 "Program LINEARID for Identification of Linear Structural Dynamic Systems," by C-B. Yun and M. Shinozuka, 6/25/90, (PB91-110312/AS).
- NCEER-90-0012 "Two-Dimensional Two-Phase Elasto-Plastic Seismic Response of Earth Dams," by A.N. Yiagos, Supervised by J.H. Prevost, 6/20/90, (PB91-110197/AS).
- NCEER-90-0013 "Secondary Systems in Base-Isolated Structures: Experimental Investigation, Stochastic Response and Stochastic Sensitivity," by G.D. Manolis, G. Juhn, M.C. Constantinou and A.M. Reinhorn, 7/1/90, (PB91-110320/AS).
- NCEER-90-0014 "Seismic Behavior of Lightly-Reinforced Concrete Column and Beam-Column Joint Details," by S.P. Pessiki, C.H. Conley, P. Gergely and R.N. White, 8/22/90, (PB91-108795/AS).
- NCEER-90-0015 "Two Hybrid Control Systems for Building Structures Under Strong Earthquakes," by J.N. Yang and A. Danielians, 6/29/90, (PB91-125393/AS).
- NCEER-90-0016 "Instantaneous Optimal Control with Acceleration and Velocity Feedback," by J.N. Yang and Z. Li, 6/29/90, (PB91-125401/AS).
- NCEER-90-0017 "Reconnaissance Report on the Northern Iran Earthquake of June 21, 1990," by M. Mehrain, 10/4/90, (PB91-125377/AS).
- NCEER-90-0018 "Evaluation of Liquefaction Potential in Memphis and Shelby County," by T.S. Chang, P.S. Tang, C.S. Lee and H. Hwang, 8/10/90, (PB91-125427/AS).
- NCEER-90-0019 "Experimental and Analytical Study of a Combined Sliding Disc Bearing and Helical Steel Spring Isolation System," by M.C. Constantinou, A.S. Mokha and A.M. Reinhorn, 10/4/90, (PB91-125385/AS).
- NCEER-90-0020 "Experimental Study and Analytical Prediction of Earthquake Response of a Sliding Isolation System with a Spherical Surface," by A.S. Mokha, M.C. Constantinou and A.M. Reinhorn, 10/11/90, (PB91-125419/AS).
- NCEER-90-0021 "Dynamic Interaction Factors for Floating Pile Groups," by G. Gazetas, K. Fan, A. Kaynia and E. Kausel, 9/10/90, (PB91-170381/AS).
- NCEER-90-0022 "Evaluation of Seismic Damage Indices for Reinforced Concrete Structures," by S. Rodriguez-Gomez and A.S. Cakmak, 9/30/90, PB91-171322/AS).
- NCEER-90-0023 "Study of Site Response at a Selected Memphis Site," by H. Desai, S. Ahmad, E.S. Gazetas and M.R. Oh, 10/11/90, (PB91-196857/AS).
- NCEER-90-0024 "A User's Guide to Strongmo: Version 1.0 of NCEER's Strong-Motion Data Access Tool for PCs and Terminals," by P.A. Friberg and C.A.T. Susch, 11/15/90, (PB91-171272/AS).
- NCEER-90-0025 "A Three-Dimensional Analytical Study of Spatial Variability of Seismic Ground Motions," by L-L. Hong and A.H.-S. Ang, 10/30/90, (PB91-170399/AS).

- NCEER-90-0026 "MUMOID User's Guide - A Program for the Identification of Modal Parameters," by S. Rodriguez-Gomez and E. DiPasquale, 9/30/90, (PB91-171298/AS).
- NCEER-90-0027 "SARCF-II User's Guide - Seismic Analysis of Reinforced Concrete Frames," by S. Rodriguez-Gomez, Y.S. Chung and C. Meyer, 9/30/90, (PB91-171280/AS).
- NCEER-90-0028 "Viscous Dampers: Testing, Modeling and Application in Vibration and Seismic Isolation," by N. Makris and M.C. Constantinou, 12/20/90 (PB91-190561/AS).
- NCEER-90-0029 "Soil Effects on Earthquake Ground Motions in the Memphis Area," by H. Hwang, C.S. Lee, K.W. Ng and T.S. Chang, 8/2/90, (PB91-190751/AS).
- NCEER-91-0001 "Proceedings from the Third Japan-U.S. Workshop on Earthquake Resistant Design of Lifeline Facilities and Countermeasures for Soil Liquefaction, December 17-19, 1990," edited by T.D. O'Rourke and M. Hamada, 2/1/91, (PB91-179259/AS).
- NCEER-91-0002 "Physical Space Solutions of Non-Proportionally Damped Systems," by M. Tong, Z. Liang and G.C. Lee, 1/15/91, (PB91-179242/AS).
- NCEER-91-0003 "Seismic Response of Single Piles and Pile Groups," by K. Fan and G. Gazetas, 1/10/91, (PB92-174994/AS).
- NCEER-91-0004 "Damping of Structures: Part 1 - Theory of Complex Damping," by Z. Liang and G. Lee, 10/10/91, (PB92-197235/AS).
- NCEER-91-0005 "3D-BASIS - Nonlinear Dynamic Analysis of Three Dimensional Base Isolated Structures: Part II," by S. Nagarajaiah, A.M. Reinhorn and M.C. Constantinou, 2/28/91, (PB91-190553/AS).
- NCEER-91-0006 "A Multidimensional Hysteretic Model for Plasticity Deforming Metals in Energy Absorbing Devices," by E.J. Graesser and F.A. Cozzarelli, 4/9/91, (PB92-108364/AS).
- NCEER-91-0007 "A Framework for Customizable Knowledge-Based Expert Systems with an Application to a KBES for Evaluating the Seismic Resistance of Existing Buildings," by E.G. Ibarra-Anaya and S.J. Fenves, 4/9/91, (PB91-210930/AS).
- NCEER-91-0008 "Nonlinear Analysis of Steel Frames with Semi-Rigid Connections Using the Capacity Spectrum Method," by G.G. Deierlein, S-H. Hsieh, Y-J. Shen and J.F. Abel, 7/2/91, (PB92-113828/AS).
- NCEER-91-0009 "Earthquake Education Materials for Grades K-12," by K.E.K. Ross, 4/30/91, (PB91-212142/AS).
- NCEER-91-0010 "Phase Wave Velocities and Displacement Phase Differences in a Harmonically Oscillating Pile," by N. Makris and G. Gazetas, 7/8/91, (PB92-108356/AS).
- NCEER-91-0011 "Dynamic Characteristics of a Full-Size Five-Story Steel Structure and a 2/5 Scale Model," by K.C. Chang, G.C. Yao, G.C. Lee, D.S. Hao and Y.C. Yeh," 7/2/91.
- NCEER-91-0012 "Seismic Response of a 2/5 Scale Steel Structure with Added Viscoelastic Dampers," by K.C. Chang, T.T. Soong, S-T. Oh and M.L. Lai, 5/17/91 (PB92-110816/AS).
- NCEER-91-0013 "Earthquake Response of Retaining Walls; Full-Scale Testing and Computational Modeling," by S. Alampalli and A-W.M. Elgamal, 6/20/91, to be published.
- NCEER-91-0014 "3D-BASIS-M: Nonlinear Dynamic Analysis of Multiple Building Base Isolated Structures," by P.C. Tsopelas, S. Nagarajaiah, M.C. Constantinou and A.M. Reinhorn, 5/28/91, (PB92-113885/AS).

- NCEER-91-0015 "Evaluation of SEAOC Design Requirements for Sliding Isolated Structures," by D. Theodossiou and M.C. Constantinou, 6/10/91, (PB92-114602/AS).
- NCEER-91-0016 "Closed-Loop Modal Testing of a 27-Story Reinforced Concrete Flat Plate-Core Building," by H.R. Somaprasad, T. Toksoy, H. Yoshiyuki and A.E. Aktan, 7/15/91, (PB92-129980/AS).
- NCEER-91-0017 "Shake Table Test of a 1/6 Scale Two-Story Lightly Reinforced Concrete Building," by A.G. El-Attar, R.N. White and P. Gergely, 2/28/91, (PB92-222447/AS).
- NCEER-91-0018 "Shake Table Test of a 1/8 Scale Three-Story Lightly Reinforced Concrete Building," by A.G. El-Attar, R.N. White and P. Gergely, 2/28/91.
- NCEER-91-0019 "Transfer Functions for Rigid Rectangular Foundations," by A.S. Veletsos, A.M. Prasad and W.H. Wu, 7/31/91, to be published.
- NCEER-91-0020 "Hybrid Control of Seismic-Excited Nonlinear and Inelastic Structural Systems," by J.N. Yang, Z. Li and A. Danielians, 8/1/91, (PB92-143171/AS).
- NCEER-91-0021 "The NCEER-91 Earthquake Catalog: Improved Intensity-Based Magnitudes and Recurrence Relations for U.S. Earthquakes East of New Madrid," by L. Seeber and J.G. Armbruster, 8/28/91, (PB92-176742/AS).
- NCEER-91-0022 "Proceedings from the Implementation of Earthquake Planning and Education in Schools: The Need for Change - The Roles of the Changemakers," by K.E.K. Ross and F. Winslow, 7/23/91, (PB92-129998/AS).
- NCEER-91-0023 "A Study of Reliability-Based Criteria for Seismic Design of Reinforced Concrete Frame Buildings," by H.H.M. Hwang and H-M. Hsu, 8/10/91, (PB92-140235/AS).
- NCEER-91-0024 "Experimental Verification of a Number of Structural System Identification Algorithms," by R.G. Ghanem, H. Gavin and M. Shinozuka, 9/18/91, (PB92-176577/AS).
- NCEER-91-0025 "Probabilistic Evaluation of Liquefaction Potential," by H.H.M. Hwang and C.S. Lee," 11/25/91, (PB92-143429/AS).
- NCEER-91-0026 "Instantaneous Optimal Control for Linear, Nonlinear and Hysteretic Structures - Stable Controllers," by J.N. Yang and Z. Li, 11/15/91, (PB92-163807/AS).
- NCEER-91-0027 "Experimental and Theoretical Study of a Sliding Isolation System for Bridges," by M.C. Constantinou, A. Kartoum, A.M. Reinhorn and P. Bradford, 11/15/91, (PB92-176973/AS).
- NCEER-92-0001 "Case Studies of Liquefaction and Lifeline Performance During Past Earthquakes, Volume 1: Japanese Case Studies," Edited by M. Hamada and T. O'Rourke, 2/17/92, (PB92-197243/AS).
- NCEER-92-0002 "Case Studies of Liquefaction and Lifeline Performance During Past Earthquakes, Volume 2: United States Case Studies," Edited by T. O'Rourke and M. Hamada, 2/17/92, (PB92-197250/AS).
- NCEER-92-0003 "Issues in Earthquake Education," Edited by K. Ross, 2/3/92, (PB92-222389/AS).
- NCEER-92-0004 "Proceedings from the First U.S. - Japan Workshop on Earthquake Protective Systems for Bridges," 2/4/92, to be published.
- NCEER-92-0005 "Seismic Ground Motion from a Haskell-Type Source in a Multiple-Layered Half-Space," A.P. Theoharis, G. Deodatis and M. Shinozuka, 1/2/92, to be published.
- NCEER-92-0006 "Proceedings from the Site Effects Workshop," Edited by R. Whitman, 2/29/92, (PB92-197201/AS).

- NCEER-92-0007 "Engineering Evaluation of Permanent Ground Deformations Due to Seismically-Induced Liquefaction," by M.H. Baziar, R. Dobry and A-W.M. Elgamal, 3/24/92, (PB92-222421/AS).
- NCEER-92-0008 "A Procedure for the Seismic Evaluation of Buildings in the Central and Eastern United States," by C.D. Poland and J.O. Malley, 4/2/92, (PB92-222439/AS).
- NCEER-92-0009 "Experimental and Analytical Study of a Hybrid Isolation System Using Friction Controllable Sliding Bearings," by M.Q. Feng, S. Fujii and M. Shinozuka, 5/15/92.
- NCEER-92-0010 "Seismic Resistance of Slab-Column Connections in Existing Non-Ductile Flat-Plate Buildings," by A.J. Durrani and Y. Du, 5/18/92.
- NCEER-92-0011 "The Hysteretic and Dynamic Behavior of Brick Masonry Walls Upgraded by Ferrocement Coatings Under Cyclic Loading and Strong Simulated Ground Motion," by H. Lee and S.P. Prawel, 5/11/92, to be published.
- NCEER-92-0012 "Study of Wire Rope Systems for Seismic Protection of Equipment in Buildings," by G.F. Demetriades, M.C. Constantinou and A.M. Reinhorn, 5/20/92.
- NCEER-92-0013 "Shape Memory Structural Dampers: Material Properties, Design and Seismic Testing," by P.R. Witting and F.A. Cozzarelli, 5/26/92.
- NCEER-92-0014 "Longitudinal Permanent Ground Deformation Effects on Buried Continuous Pipelines," by M.J. O'Rourke, and C. Nordberg, 6/15/92.
- NCEER-92-0015 "A Simulation Method for Stationary Gaussian Random Functions Based on the Sampling Theorem," by M. Grigoriu and S. Balopoulou, 6/11/92, (PB93-127496/AS).
- NCEER-92-0016 "Gravity-Load-Designed Reinforced Concrete Buildings: Seismic Evaluation of Existing Construction and Detailing Strategies for Improved Seismic Resistance," by G.W. Hoffmann, S.K. Kunnath, J.B. Mander and A.M. Reinhorn, 7/15/92, to be published.
- NCEER-92-0017 "Observations on Water System and Pipeline Performance in the Limón Area of Costa Rica Due to the April 22, 1991 Earthquake," by M. O'Rourke and D. Ballantyne, 6/30/92, (PB93-126811/AS).
- NCEER-92-0018 "Fourth Edition of Earthquake Education Materials for Grades K-12," Edited by K.E.K. Ross, 8/10/92.
- NCEER-92-0019 "Proceedings from the Fourth Japan-U.S. Workshop on Earthquake Resistant Design of Lifeline Facilities and Countermeasures for Soil Liquefaction," Edited by M. Hamada and T.D. O'Rourke, 8/12/92.
- NCEER-92-0020 "Active Bracing System: A Full Scale Implementation of Active Control," by A.M. Reinhorn, T.T. Soong, R.C. Lin, M.A. Riley, Y.P. Wang, S. Aizawa and M. Higashino, 8/14/92, (PB93-127512/AS).
- NCEER-92-0021 "Empirical Analysis of Horizontal Ground Displacement Generated by Liquefaction-Induced Lateral Spreads," by S.F. Bartlett and T.L. Youd, 8/17/92, to be published.
- NCEER-92-0022 "IDARC Version 3.0: Inelastic Damage Analysis of Reinforced Concrete Structures," by S.K. Kunnath, A.M. Reinhorn and R.F. Lobo, 8/31/92, to be published.
- NCEER-92-0023 "A Semi-Empirical Analysis of Strong-Motion Peaks in Terms of Seismic Source, Propagation Path and Local Site Conditions, by M. Kamiyama, M.J. O'Rourke and R. Flores-Berrones, 9/9/92.
- NCEER-92-0024 "Seismic Behavior of Reinforced Concrete Frame Structures with Nonductile Details, Part I: Summary of Experimental Findings of Full Scale Beam-Column Joint Tests," by A. Beres, R.N. White and P. Gergely, 9/30/92, to be published.
- NCEER-92-0025 "Experimental Results of Repaired and Retrofitted Beam-Column Joint Tests in Lightly Reinforced Concrete Frame Buildings," by A. Beres, S. El-Borgi, R.N. White and P. Gergely, 10/29/92, to be published.

- NCEER-92-0026 "A Generalization of Optimal Control Theory: Linear and Nonlinear Structures," by J.N. Yang, Z. Li and S. Vongchavalitkul, 11/2/92.
- NCEER-92-0027 "Seismic Resistance of Reinforced Concrete Frame Structures Designed Only for Gravity Loads: Part I - Design and Properties of a One-Third Scale Model Structure," by J.M. Bracci, A.M. Reinhorn and J.B. Mander, 12/1/92, to be published.
- NCEER-92-0028 "Seismic Resistance of Reinforced Concrete Frame Structures Designed Only for Gravity Loads: Part II - Experimental Performance of Subassemblages," by L.E. Aycardi, J.B. Mander and A.M. Reinhorn, 12/1/92, to be published.
- NCEER-92-0029 "Seismic Resistance of Reinforced Concrete Frame Structures Designed Only for Gravity Loads: Part III - Experimental Performance and Analytical Study of a Structural Model," by J.M. Bracci, A.M. Reinhorn and J.B. Mander, 12/1/92, to be published.
- NCEER-92-0030 "Evaluation of Seismic Retrofit of Reinforced Concrete Frame Structures: Part I - Experimental Performance of Retrofitted Subassemblages," by D. Choudhuri, J.B. Mander and A.M. Reinhorn, 12/8/92, to be published.
- NCEER-92-0031 "Evaluation of Seismic Retrofit of Reinforced Concrete Frame Structures: Part II - Experimental Performance and Analytical Study of a Retrofitted Structural Model," by J.M. Bracci, A.M. Reinhorn and J.B. Mander, 12/8/92, to be published.
- NCEER-92-0032 "Experimental and Analytical Investigation of Seismic Response of Structures with Supplemental Fluid Viscous Dampers," by M.C. Constantinou and M.D. Symans, 12/21/92, to be published.
- NCEER-92-0033 "Reconnaissance Report on the Cairo, Egypt Earthquake of October 12, 1992," by M. Khater, 12/23/92.

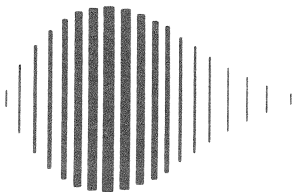

National Center for Earthquake Engineering Research
State University of New York at Buffalo